


Fairing installation instructions

Starting from the ship end of the cable install the fairing as follows using the diagram as a reference

- 1 Attach a cable clamp to the cable using stainless steel straps and clips.
Use the appropriate tool for this operation as per manufacturers instructions.
- 2 Link 3 Carbine clips together and attach one end to the loop of the cable clamp.
- 3 Wrap a length of fairing around the cable and fix with the Velcro strip and cable ties.
See diagram for orientation.
- 4 Attach the other end of the 3 Carbine links through the eyelet hole of the adjacent length of fairing.
- 5 Attach another length of fairing around the cable with its Velcro and cable ties.
- 6 When fastened in place link adjacent fairings with a Carbine link through the eyelet holes as per diagram.
- 7 Repeat until 16 fairing lengths are installed.
- 8 Attach a second cable clamp in a similar manner to the first.
- 9 Install another 16 fairing lengths.
- 10 Continue in this manner with 1 cable clamp per 16 fairing lengths until a cable is complete.
This should be a total of 10 cable clamps and 160 fairing lengths

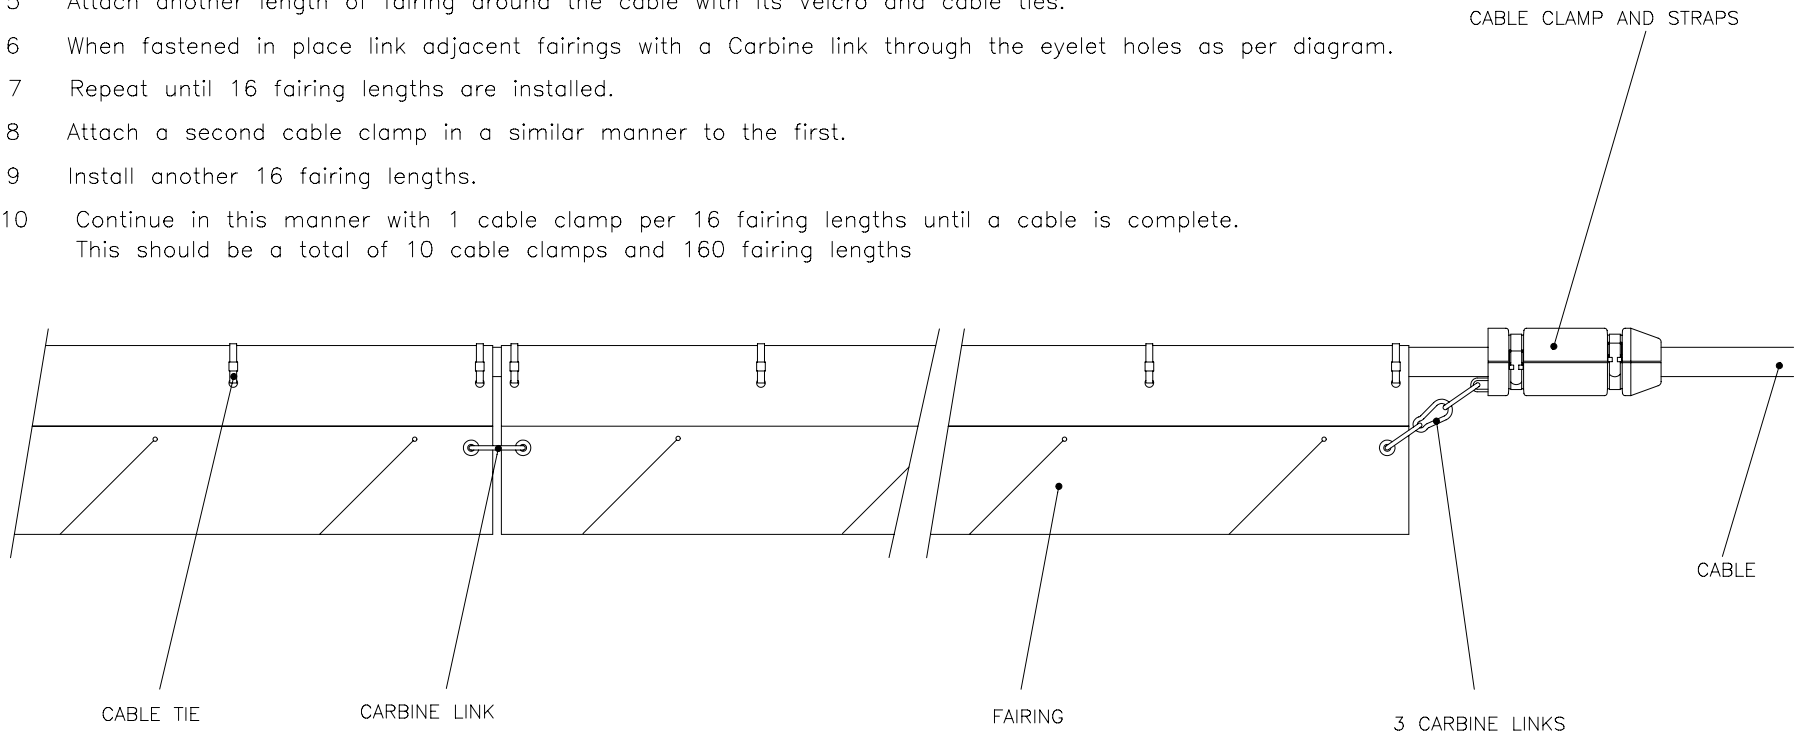

DATE 23Feb'04				CWA DESIGN COPYRIGHT NOT TO BE USED OR RE- PRODUCED WITHOUT EXPRESS PERMISSION FROM CWA	TOLERANCES :- UNLESS OTHERWISE STATED NO DEC PLACE ±0.5 ANGULAR ±1/4° 1 DEC PLACE ± 0.3 2 DEC PLACE ±0.15 HOLES UP TO 12.7mm +0.10mm -0 ALL COAXIAL DIAS CONCENTRIC WITHIN 0.05mm ALL HOLES ON PITCH CIRCLES WITHIN 0.10mm OF TRUE POS.	REMOVE ALL SHARP EDGES WITH 0.40 RAD OR CHAMFER UNLESS OTHERWISE STATED	MATERIAL	FINISH	SURFACE FINISH 0.8 UNLESS OTHERWISE STATED
DRAWN fjj							DRWG No. 10-3301		
SCALE NTS	23Feb'04		1	CWA PRODUCTS LIMITED HOOK BASINGSTOKE HANTS			TITLE ø36.8 LEAD-IN FAIRING INSTALLATION		
CHECKED	DATE	C.NOTE	ISS						